

SAFETY RECALL

Hazard: A yellow protective cap in limited instances may have been left on one of the two smoke sensors in affected products during the manufacturing process, which could compromise the smoke alarms' ability to detect smoke.

Description: This recall involves two models of Kidde dual sensor (photoelectric and ionization) smoke alarms manufactured between September 10, 2016 and Oct. 13, 2017. Models include: PI2010CA (AC/hardwired) and PI9010CA (battery).



Look for this pill shaped design on the front of the unit. This feature is slightly raised and is unique to this alarm.



Model PI2010CA Ionization & Photoelectric


Locate the model number. The model should read **PI9010CA** or **PI2010CA**.

REPLACE ALARMS AUTONOME
REPLACE ALARMS AUTONOME
6
ISSUE NO. XXXXXXX

Locate date code. If the date code is within range (**2016 Sep. 10** through **2017 Oct. 13**) the alarm may be affected.

Turn the alarm on its side and look at the opening closest to the locking tab. If a yellow cap can be seen in the opening the unit is affected and must be replaced.

Affected

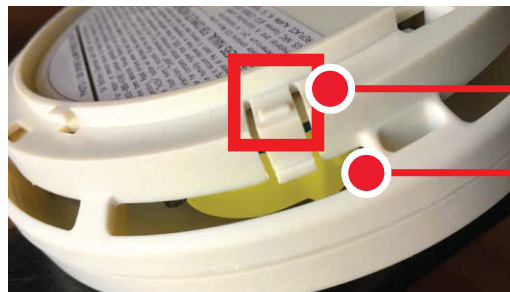

Locking tab.

Yellow cap is visible, **request a replacement immediately and reinstall until replacement arrives.**

Not Affected



No yellow cap is visible. Unit is not affected.

Remedy: Replace affected smoke alarms that contain the yellow protective cap.

Consumer Contact: Go online to www.kiddecana.com and click on "Product Safety Recall" for detailed instructions on how to identify if your alarm is an affected smoke alarm, and for other information about the recall. Or call Kidde toll-free at 1-833-551-7739 from 8:30 a.m. to 5 p.m. ET Monday through Friday and Saturday, and Sunday from 9 a.m. to 3 p.m.